

TECHNICAL BULLETIN

CONFIDENTIAL

SUBJECT:
TLS UPDATE FOR ELAN

TECHNICAL BULLETIN: 16-12
DATE: OCTOBER 11, 2016

Available to all authorized Triton distributors and third party service providers.

SOFTWARE UPDATE REQUIRED.

TRITON RELEASES NEW TLS UPDATE FOR ALL CUSTOMERS WHO PROCESS WITH ELAN.

This document describes an upgrade load file which allows Xscale, X2, or X3 ATMs to accept SSL host certificates for Elan. The ATM **software must be updated** so that the newer certificates can be accepted.

Beginning October 05, 2016, all Triton parts orders, repair orders, new ATMs and refurbished ATMs will ship with this update pre-loaded. Elan has released their update schedule to their customers.

To verify whether or not TLS files have been loaded onto ATM:

Go to *Management Functions > Terminal Status > Configuration Summary*. Near the beginning of the first paragraph of the configuration summary, the ATM tsocket version can be found.

```
Terminal ID: 745ANTISKIMX26
9/23/2016 10:48:23 AM

*** Configuration Summary ***

Prog Version: 4.0.0C
Program Build: 4.0.0.37
09/19/2016 1:37:28 AM
Screen File: tcscsf.tsm
Version Number: SCSF0018
07/05/2016 05:05:11 PM
Filename: TCEShutdown.exe
Version Number: 1.0.0.1
Size: 12 KB
Date and Time: 09/19/2016 1:37:28 AM
Filename: TCEKeyboard.exe
Version Number: 1.0.1.0
Size: 55 KB
Date and Time: 09/19/2016 1:37:28 AM
Filename: tsocketocx.ocx
Version Number: 3.0.0.2
Size: 324 KB
Date and Time: 10/05/2015 1:10:28 AM
```

If the tsocketocx file is version 3.0.0.2 or higher, no further action is required. If tsocketocx is prior to 3.0.0.2, a software update must be performed.

See page 2 for more information.

If you have questions regarding this Technical Bulletin, please contact Technical Support at 1-228-575-3100 or toll free in the U.S. / Canada 1-800-259-6672. Visit www.tritonatm.com for additional information. For all ATM parts, repair, and training needs, visit www.atmgurus.com.

TECHNICAL BULLETIN


CONFIDENTIAL

This release includes all necessary certificates for the following units:

RL1600	RL2000	Traverse (RL3300)
RL5000	FT5000	RT2000
ARGO 7	ARGO 12	ARGO 15

No specific hardware is required for the update. Software must be version 2.4.0 or greater. If TLS files have not been loaded onto ATM, access update at www.tritonatm.com.

xu20tsck3.0.0.3.tlf for Xscale update
xu30tsck3.0.0.2d.tfv for X2 CE5 update
t-us-tsck-3.0.0.2d.tr6 for X2 CE6 update
t-us-tsck-3.0.0.2d.tr7 for X3 update

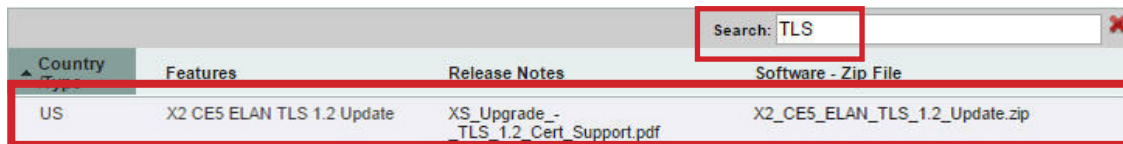

Country	Features	Release Notes	Software - Zip File
US	X2 CE5 ELAN TLS 1.2 Update	XS_Upgrade_-_TLS_1.2_Cert_Support.pdf	X2_CE5_ELAN_TLS_1.2_Update.zip

If you have questions regarding this Technical Bulletin, please contact Technical Support at 1-228-575-3100 or toll free in the U.S. / Canada 1-800-259-6672. Visit www.tritonatm.com for additional information.
For all ATM parts, repair, and training needs, visit www.atmgurus.com.