

TECHNICAL BULLETIN: 13-24

DATE: August 28, 2013

SUBJECT: [X2 Docking Board Dip Switch Settings](#)

AVAILABILITY: All Authorized Triton Distributors and Third Party Service Providers


This bulletin addresses:	
	Hardware Service Issues
	New Kit/Parts Available
	Software Announcements
X	Technical Tips

Recommended Implementation is:	
	Now for all affected units
	All affected units during next service visit
	Optional
X	No implementation required

DESCRIPTION:

With the introduction of the ARGO unit, Triton is combining inventory and reducing the unit specific parts available. All the RL53 are now being built with docking board [09100-00153](#). The Docking Board Assembly **#06200-00159** is no longer available; instead order part **#09100-00153**. The new board is backwards compatible however there is a slight change in the Dip Switches.

The previous board had 5 dip switches to set. The new board only has 4 dip switches. To avoid confusion, a guide has been printed directly on the board showing to how to set the switches depending on the unit configuration.

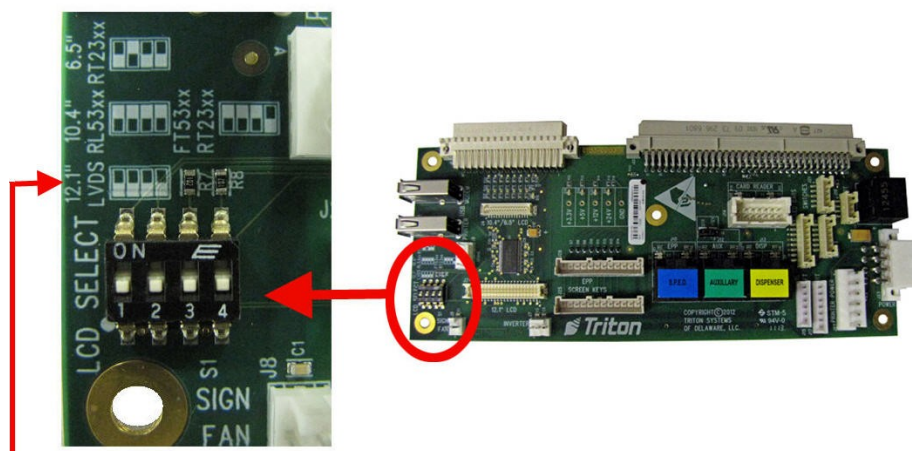

(photo above shows the switches set for the 12.1" display, all switches in the OFF position)

If you have questions regarding this Technical Bulletin, please contact Technical Support at 1-228-575-3100 or toll free in the U.S. / Canada 1-800-259-6672.

Visit www.Triton.com for additional information.

For all ATM Parts, Repair, and Training needs, visit www.atmgurus.com.